



✉ 2621 Merced Avenue El Monte, CA 91733
 📞 Technical Support (626) 443-7451
 🌐 transgo.com E-mail: support@transgo.com

NEW PRODUCT!

Announcement Number: **S06162601**



8L90-ACCUM

1-3-5-6-7 Accumulator Piston Kit

Fits: 8L45, 8L90 GEN1


Drop-in fix for worn 1-3-5-6-7 accumulator circuit

This kit upgrades the accumulator circuit with a hard-anodized aluminum piston fitted with a PTFE sealing ring. PTFE conforms better to irregularities, including bores worn slightly oval. PTFE is also more tolerant of bore glazing and uneven wear that can quickly damage or compromise a rubber seal.

Also included is a calibrated OE-style ovate wire spring. The TransGo spring design matches the factory spring style maintaining the intended accumulator action while reducing spring stress for a durable, lasting repair.


Corrects/Prevents/Reduces:

- Delayed forward engagement
- Poor shift quality
- 2-3 and 4-5 upshift or downshift complaints
- Burnt 1-3-5-6-7 frictions

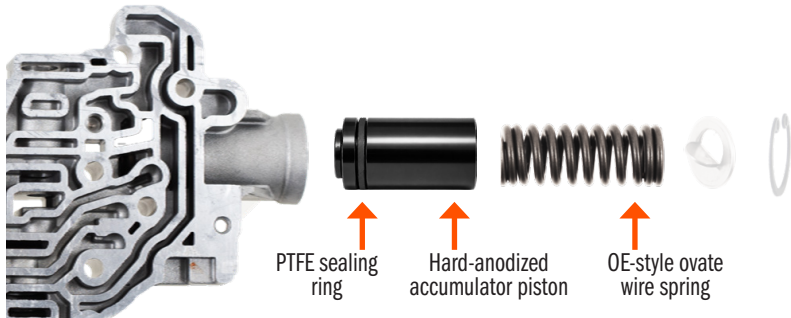


GEN1 (2015-2023)

GEN2 (2022-on)

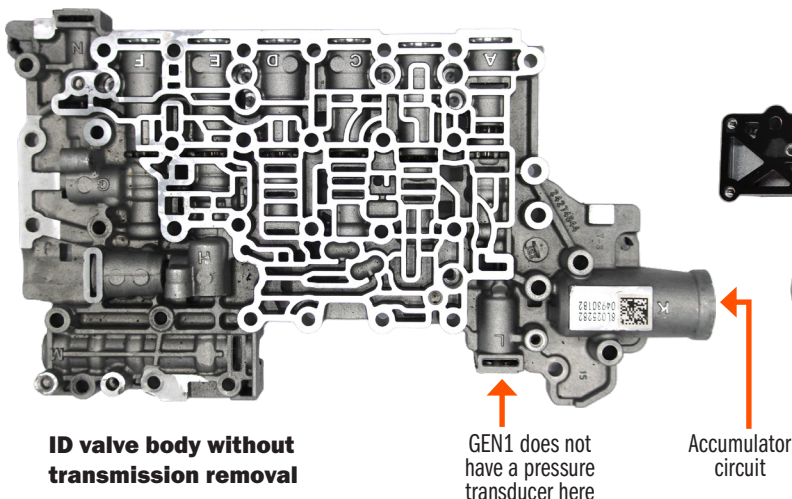

ID valve body without transmission removal

GEN1 does not have a pressure transducer here

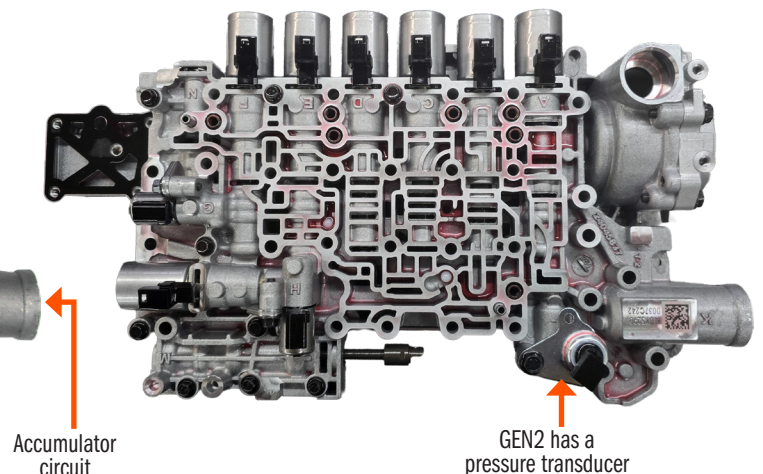

GEN2 has a pressure transducer

**ENGINEERED FOR PERFORMANCE.
DESIGNED FOR DURABILITY.**

©TransGo. All rights reserved. TransGo®, SHIFT KIT®, SK® and Reprogramming Kit™ are registered and licensed trademarks.

